PAGE: 1

PRINT DATE: 04/01/92

193

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CRITICAL HARDWARE

NUMBER: H4-18G-TK010-X

SUBSYSTEM NAME: ELECTRICAL POWER GENERATION - CRYO, GENERIC

REVISION: 1 11/12/91

PART MAME VENDOR MAME

PART NUMBER VENDOR NUMBER

a LRU

TANK SUBASSEMBLIES 5 C2

MC232-0033-0300

BEECH

15548-1001

■ LRU : TANK :

TANK SUBASSEMBLIES, 02

MC282-0112-0100

BALL AEROSPACE

163195-500

PART DATA

EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:

a REFERENCE DESIGNATORS:

40V45TK010

40V45TX020

40V45TK400

40V45TK450 40V45TK600

40V45TK760

40V45TK770

40Y45TK780

40V45TK790

# CUANTITY OF LIKE ITEMS: 3-9

MISSION DEPENDENT

o FUNCTION:

PROVIDES STORAGE OF CRYOGENIC OXYGEN FOR ECLSS AND FUEL CELL OPERATION.

PAGE: 6 PRINT DATE: 04/01/92 FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CRITICAL FAILURE MODE NUMBER: M4-18G-TK010-02 REVISION# I 11/12/91 R SUBSYSTEM: ELECTRICAL POWER GENERATION - CRYO, GENERIC LRU : DXYGEN TANK SUBASSEMBLY CRITICALITY OF THIS ITEM MAME: TANK SUBASSEMBLIES, 32 FAILURE MODE: 182 ■ FAILURE HODE: LOSS OF ARGULUS VACUUM MISSION PHASE: PL PRELAUNCH Lů Lifi-Off 00 DE-ORAIT LS LANDING SAFING ■ VEHICLE/PAYLOAD/KIT EFFECTIVITY: 102 COLUMBIA : 103 DISCOVERY : 104 **ATLANTIS** : ICS ENDEAVOUR a CAUSE: LEAKAGE OF OUTER SHELL, VIBRATION, CORROSION, MISHANDLING E CRITICALITY 1/1 DURING INTACT ABORT CHLY? NO & REDUNDANCY SCREEN A) PASS 3 B) FAIL •• C) PASS PASS/FAIL RATIONALE: ≖ A) RÉDUNDANCY SCREEN B - FAILURE MODE IS NOT DETECTABLE IN FLIGHT SINCE VEHICLE IS IN A VACUUM ENVIRONMENT ON ORBIT. **□** ()

■ (A) SUBSYSTEM:

LOSS OF VACUUM HOULD RESULT IN INCREASED HEAT LEAKAGE TO THE O2 TANK AND RESULTANT LOSS OF O2 THROUGH THE RELIEF VALVE EXCEPT FOR ON CRBIT OPERATIONS.

- FAILURE EFFECTS -

FAGE: 7

PRINT DATE: 04/01/92

189

FAILURE MODES EFFECTS AMALYSIS (FMEA) -- CRITICAL FAILURE MODE MUMBER: M4-18G-TK010-02

- (8) INTERFACING SUBSYSTEM(S): POSSIBLE REDUCTION OF OZ CONSUMABLES AVAILABLE FOR THE ECLSS AND FUEL CELL POWERPLANT OPERATION.
- (D) CREW, VEHICLE, AND ELEMENT(S): SAME AS (C)
- (E) FUNCTIONAL CRITICALITY EFFECTS:

  POSSIBLE LOSS OF CREM/VEHICLE DUE TO TANK RUPTURE (CIL 04-1-TK010-01)

  IF AN ADDITIONAL FAILURE RESULTS IN LOSS OF OVERBOARD RELIEF CAPABILITY.
  - DISPOSITION RATIONALE -
- A) DESIGN: PRESSURE VESSEL (INCONEL 718) AND OUTER SHELL (ALUMINUM 2219) ARE ALL WELDED CONSTRUCTION. VACUUM DESIGN LIFE 5 YEARS MINIMUM. OUTER SHELL COATED WITH KOROPON FOR CORROSION PROTECTION. VAC-ION PUMP ENABLES SROUND VERIFICATION AND MAINTENANCE OF VACUUM. SHIPPING CONTAINER PREVENTS HANDLING DAMAGE.
- (B) TEST: QUALIFICATION TEST INCLUDE: MECHANICAL SHOCK (20 G), SINUSOIDAL VIBRATION (+/- 0.25 G PEAK), RANDOM VIBRATION (0.008 G SQ/HZ MAXIMUM FOR 48 MINUTES), ACCELERATION (+/- 5 G FOR 5 MINUTES PER AXIS). VIERATION MET 100 MISSION EQUIVALENT WITH TANK FULL AND 25 MISSION EQUIVALENT WITH TANK OFFLOADED.

ACCEPTANCE TESTS INCLUDE: VAC-ION PUMP TEST VERIFIES ANNULUS VACUUM INTEGRITY. MINIMUM OQ/OM HEAT LEAK TEST AT 110 DEG F ALSO VERIFIES ANNULUS VACUUM INTEGRITY.

OMRSD: TANK ASSEMBLY IS STRUCTURALLY INSPECTED DURING EVERY ORBITER MAINTENANCE DOWN PERIOD (OMDP). VAC-ION PUMP IS POWERED UP EVERY TURNAROUND AND EVERY 6 MONTHS DURING TANK STORAGE.

■ (C) INSPECTION: RECEIVING INSPECTION ALLOY COMPOSITION AND HEAT TREAT CERTIFICATION VERIFIED BY INSPECTION.

CONTAMINATION CONTROL CLEANLINESS LEVEL OF 200A IS MAINTAINED. PAGE: 8

PRINT DATE: 04/01/92

136

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CRITICAL FAILURE MODE NUMBER: M4-18G-TK010-02

HONDESTRUCTIVE EVALUATION
HELDMENTS VERIFIED BY A SPECIAL LEVEL PENETRANT INSPECTION. ULTRASONIC
AND RADIOGRAPHIC INSPECTION BY QUALIFIED/CERTIFIED NOT PERSONNEL.

## CRITICAL PROCESSES

WELDING IS CONTROLLED AND VERIFIED BY MANUFACTURING OPERATING PROCEDURE, CERTIFICATION OF OPERATORS, VISUAL INSPECTION, THERMOGRAPH, AND X-RAY. PROCESS CONTROL COUPON, AFTER FORMING AND BEFORE WELDING, IS ANALYZED FOR COMPOSITION, GRAIN STRUCTURE AND TENSILE STRENGTH. HEAT TREATMENT AND KOROPON COATING APPLICATION IS VERIFIED BY INSPECTION.

## TESTING.

TANK ANNULUS IS EVACUATED AT ELEVATED TEMPERATURE FOR 21 DAYS; THE ANNULUS VACUUM LEVEL IS VERIFIED BY TANK ION PUMP INSTRUMENTATION AT THE VENDOR AND PERIODICALLY DURING STORAGE. MATERIALS ARE VERIFIED COUPON TESTED FOR LOAD STRENGTH. VESSELS ARE PRESSURE-TESTED AND LEAK TESTED AND VERIFIED BY INSPECTION.

## PACKAGING/HANDLING

INSPECTION VERIFIES PARTS ARE PACKAGED AND PROTECTED PER REQUIREMENTS INCLUDING HANDLING REQUIREMENT FOR FRACTURE-CRITICAL HARDWARE.

## ■ (D) FAILURE HISTORY:

CAR NO. AB3696-010 SUPPLIER. QUALIFICATION
CURING RANDOM VIBRATION OF AN H2 QUALIFICATION TANK ASSEMBLY, TANK
PRESSURE COULD NOT BE MAINTAINED BELOW A SPECIFIED LEVEL, CURING
DETANK, GAS WAS DISCOVERED ESCAPING IN THE CONVERTER/VAC-ION PUMP AREA.
REMOVAL OF THE CONVERTER REVEALED THE PUMP HIGH, VOLTAGE
RCO-TO-INSULATOR END CAP HAD FRACTURED. ANALYSIS INDICATED THAT THE
VAC-ION END CAP WAS OVERSTRESSED DURING VIBRATION TESTING AS A RESULT
OF BEING SUBJECTED TO EXCESSIVE VIBRATION LEVELS IMPOSED BY THE TEST
FIXTURE.

CORRECTIVE ACTION INCLUDED A MODIFICATION OF THE VIBRATION TEST FIXTURE TO PROVIDE A MORE REALISTIC VIBRATION TEST.

CAR NO. AB7017-DID SUPPLIER, ATP DURING END ITEM ACCEPTANCE TESTING OF AN H2 TANK ASSEMBLY, AN INCREASE IN TANK ANNULUS PRESSURE WAS NOTED. AFTER AN EXTENSIVE INVESTIGATION AND A VERIFICATION OF THE REBUILT TANK ASSEMBLY, THE MOST PROBABLE CAUSE FOR THE FAILURE WAS DETERMINED TO BE A SMALL CRACK/POROSITY IN THE HEATER COLD LEAD SHEATH.

ATTEMPTS TO DEVISE BETTER PROBE SCREENING TESTS WERE UNSUCCESSFUL; THE END ITEM ACCEPTANCE TEST PROVED TO BE THE MOST PRACTICAL AND RELIABLE SCREENING TEST.

PAGE: 9

PRINT DATE: 04/01/92 19;

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CRITICAL FAILURE MODE NUMBER: M4-18G-TKD10-02

α (ξ) OPERATIONAL USE:

FOR FAILURE IN ATMOSPHERIC FLIGHT, CREW WILL BE ALERTED AND WILL DEACTIVATE ASSOCIATED TANK HEATERS.

- APPROVALS -

RELIABILITY ENGINEERING: M. D. WEST

CESIGN ENGINEERING : M. M. SCHEIERN CUALITY MANAGER : O. J. BUTTKER

NASA RELIABILITY

MASA SUBSYSTEM MANAGER :

MASA QUALITY ASSURANCE :